174 Raymond Rd. Suite B Candia, NH. 03034 Phone: 603-782-0870

INVOICE 885

Org. Est. # 000916

Invoice from History

SEACOAST SPECIALIST CARS LLC

174 RAYMOND ROAD SUITE B Candia, NH 03034

Printed Date: 05/15/2025 Work Completed: 05/12/2025

1989 Porsche - 944 - 2.7L, In-Line4 (164CI) VIN(A)

Lic#: Odometer In: 113790 Odometer Out: 113865

Cellular 603-782-0870		VIN # : WP0AA0945 KN451115			
Part Description / Number	Qty	Sale	Ext	Labor Description Ext	
ATF	2.00	13.39	26.78	PLEASE PERFORM USED CAR CHECK AND ADVISE. 226.95	
DEXRON III				PERFORMED USED CAR CHECK OVER, FOUND ITEMS OF	
HOOD STRUT	2.00	30.78	61.56	CONCERN; -PASSENGER SIDE WINDOW SWITCH DOES NOT LOWER	
944 511 351 01				WINDOW	
KONI SHOCK ABSORBER 8641-1038SPORT	2.00	254.74	509.48	TO WEAK LIFTING STRUTS, SWITCH ACTUATES MOTOR BUT	
BUFFER 951 343 527 00	2.00	39.39	78.78	HATCH DOES NOT LIFT ON ITS OWN, USING KEY TO OPEN HATCH HAS THE SAME PROBLEM- ACTUATES MOTOR BUT HATCH DOES NOT LIFT ON ITS OWN	
STRUT MOUNT 951 343 018 31	2.00	400.00	800.00	-HOOD STRUTS WEAK, DO NOT HOLD HOOD OPEN -LOCKING THE DOORS THEN UNLOCKING THEM WILL	
SEAL RING	2.00	13.70	27.40	TRIGGER THE ALARM WHEN THE DOOR/HOOD IS OPENED, LOCKING/UNLOCKING THE DOORS DOES NOT DISENGAGE ALARM, DISCONNECTING NEGATIVE BATTERY TERMINAL	
133 412 367 NUT N 022 150 1	2.00	5.74	11.48	STOPS ALARM FROM SOUNDING AND RESETS SYSTEM AND CAR STARTS/RUNS AS DESIRED, HOWEVER LOCKING AND	
FOG LAMP	1.00	239.19	239.19	UNLOCKING THE DOORS STARTS CYCLE OVER AGAIN -BOTH FOG LIGHTS ARE MISSING ONE MOUNTING SCREW EACH, DRIVERS SIDE GLASS IS BROKEN	
944 631 201 01 SEALING RING	1.00	5.54	5.54	-LOCKING LUG NUTS ARE MISSING LOCKING MECHANISMS -PASSENGER SIDE WHEEL BEARING IS LOOSE	
944 106 928 00 SEALING RING	1.00	1.83	1.83	-DRIVERS SIDE INNER TIE ROD IS LOOSE -LOWER RADIATOR HOSE HAS MINOR LEAK WHERE IT CONNCECTS TO RADIATOR, CHECKED TIGHTNESS OF CLAMP.	
<i>N 043 808 1</i> HOSE	1.00	33.27	33.27	CLAMP WAS NOT LOOSE, RECOMMEND REPLACING HOSE AND CLAMPS	
944 106 249 03 MOBIL1 5W-50	7.00	13.98	97.86	-WINE COMING FROM TIMING BELT OR BALANCE SHAFT -STRUT BUMP STOPS ARE FALLING APART -TIRES FEEL OUT OF BALANCE OR HAVE FLAT SPOTS FROM	
5W50 OIL FILTER	1.00	32.26	32.26	SITTING, RECOMMEND CHECKING BALANCE OF WHEELS/TIRES, TIRES ARE DATED 2020	
944 107 201 11 SEAL RING	1.00	4.88	4.88	CUSTOMER STATES POWER STEERING LEAK 226.95 EXISTS	
900 123 049 30 Shop Supplies			34.95	CONFIRMED CUSTOMER COMPLAINT, FOUND UPPER	
				CUSTOMER REQUESTS NEW HAMPSHIRE STATE 45.00 INSPECTION	
				CUSTOMER STATES DRIVERS SIDE VISOR DOESN'T n/c STAY UP CONFIRMED CUSTOMER COMPLAINT, FOUND VISOR ROD OUTER LAYER TO BE BROKEN, RECOMMEND REPLACING VISOR. INSTALLED PREVIOUS OWNER SUPPLIED NEW VISOR - VISOR NOW OPERATES AS DESIGNED.	
				REPLACE POWER STEERING RESERVOIR LINE 295.04	

Visit us on the web: www.sscarsnh.com

Service Advisor: Vagi, Tom, Tech: Rundlett, Max; STARLING, KEVIN

Email Address: tvagi@sscarsnh.com

174 Raymond Rd. Suite B Candia, NH, 03034 Phone: 603-782-0870

INVOICE

885

Org. Est. # 000916

Invoice from History

174 RAYMOND ROAD SUITE B

SEACOAST SPECIALIST CARS LLC

Candia, NH 03034

Cellular 603-782-0870

Printed Date: 05/15/2025 Work Completed: 05/12/2025

1989 Porsche - 944 - 2.7L, In-Line4 (164CI) VIN(A)

Lic#: Odometer In: 113790

Odometer Out: 113865

VIN #: WP0AA0945 KN451115

Part Description / Number Qty Sale **Ext Labor Description** Ext

> REPLACED POWER STEERING RESERVOIR LINE, BLED SYSTEM, TOPPED FLUID OFF TO FACTORY SPEC

REPLACE HOOD STRUTS 68.09 REPLACED HOOD STRUTS

PERFORMED FOUR WHEEL ALIGNMENT

REPLACE FRONT STRUTS

PERFORM FOUR WHEEL ALIGNMENT

2.269.50

299.95

REMOVED AND DISASSEMBLED OLD STRUT AND SPRING ASSEMBLIES, CUT STRUT HOUSINGS TO OLD INSERTS, INSTALLED NEW STRUT INSERTS INTO MODIFIED HOUSINGS, REASSEMBLED STRUT AND SPRING ASSEMBLIES WITH NEW UPPER MOUNTS AND GASKET. INSTALLED ONTO VEHICLE. TEST DROVE VEHICLE, SUSPENSION IS FUNCTIONING AS DESIGNED.

453.90

SALES REQUESTS CHECK AND ADJUST TIMING BELT/BALANCE SHAFT TENSION

CHECKED TIMING BELT TENSION, FOUND TENSION TO BE 3.0, NO ADJUSTMENT MADE, CHECKED BALANCE SHAFT TENSION,

FOUND TENSION TO BE 2.0, ADJUSTED TENSION TO 3.0. ADDITIONAL TIME TO EXTRACT TIMING COVER 567.38

BOLTS

136.17 REPLACE LEFT FRONT FOG LAMP

REPLACED LEFT FRONT FOG LAMP, MOVED BULB FROM OLD HOUSING TO NEW.

SALES STATES DRIVERS SIDE MIRROR ASSEMBLY IS LOOSE. PLEASE CHECK AND ADVISE.

REMOVED DRIVERS SIDE MIRROR ASSEMBLY, FOUND SPRING DETENT SCREW TO BE LOOSE. TIGHTENED SCREW WITH THREAD LOCKER, RE INSTALLED SIDE MIRROR ASSEMBLY ONTO DOOR, MIRROR FUNCTIONS AS DESIRED.

SALES REQUESTS CHECK COOLANT LEAK AT LOWER RADIATOR HOSE

1,202.84

567.38

CONFIRMED CUSTOMER COMPLAINT, PRESSURIZED COOLING SYSTEM, FOUND COOLANT TO BE LEAKING FROM LOWER RADIATOR HOSE, TEMP SENSOR, AND FITTING THAT LEADS TO RESERVOIR, WAS ABLE TO FREE UP CLAMP ON LOWER HOSE, TIGHTENING CLAMP STOPPED LEAK, RECOMMEND REPLACING GASKETS AT TEMP SENSOR AND FITTING. REPLACED GASKETS AT TEMP SENSOR AND FITTING. RECHECKED FOR LEAKS - NONE EXIST.

Visit us on the web: www.sscarsnh.com

Service Advisor: Vagi, Tom, Tech: Rundlett, Max; STARLING, KEVIN

Email Address: tvaqi@sscarsnh.com

Page 2 of 4

174 Raymond Rd. Suite B Candia, NH. 03034 Phone: 603-782-0870 INVOICE

885

Ora. Est. # 000916

Invoice from History

174 RAYMOND ROAD SUITE B

SEACOAST SPECIALIST CARS LLC

Candia, NH 03034

Cellular 603-782-0870

Part Description / Number

Printed Date: 05/15/2025 Work Completed: 05/12/2025

1989 Porsche - 944 - 2.7L, In-Line4 (164CI) VIN(A)

Lic #: Odometer In: 113790
Odometer Out: 113865

VIN # : WP0AA0945 **KN451115**

Qty Sale Ext Labor Description Ext

CUSTOMER REQUESTS ADJUST REAR HATCH

226.95

FOUND REAR HATCH TO NOT UNLOCK WHEN KEY IS TURNED IN HATCH OR BUTTON PUSHED AT KICK PANEL, ADJUSTED HATCH STRIKERS, REAR HATCH NOW UNLOCKS AS DESIRED WITH KEY AND BUTTON.

CUSTOMER STATES ALARM GOES OFF WHEN 1,2
DOOR IS OPENED

1,225.53

ALARM

CONFIRMED CUSTOMER COMPLAINT, IF YOU ARM THE ALARM THEN DISARM THE ALARM WITH THE DRIVERS DOOR LOCK, THE ALARM WILL SOUND ONCE THE DOOR/HATCH/HOOD IS OPENED, DISCONNECTING BATTERY RESETS THE CYCLE. CHECKED FOR SIGNALS AT THE ALARM MODULE; TERMINAL 31 SHOULD HAVE GROUND, FOUND GROUND, TERMINAL T-SHOULD HAVE GROUND WHEN DOOR IS OPENED. FOUND GROUND WHEN DOOR IS OPENED. TERMINAL 15 SHOULD HAVE BATTERY VOLTAGE WITH IGNITION ON, FOUND BATTERY VOLTAGE WITH IGNITION ON, TERMINAL 30 SHOULD HAVE BATTERY VOLTAGE AT ALL TIMES, FOUND BATTERY VOLTAGE AT ALL TIMES, TERMINAL MK SHOULD HAVE GROUND WITH HOOD OPEN, FOUND GROUND WITH HOOD OPEN, TERMINAL E SHOULD HAVE GROUND WITH DOOR LOCKED, FOUND GROUND WITH DOOR LOCKED, TERMINAL A SHOULD HAVE GROUND WITH DOOR UNLOCKED, NO GROUND FOUND ON DRIVERS SIDE WITH DOOR LOCKED. REMOVED DOOR PANEL TO INSPECT WIRING FROM THE BODY INTO THE DOOR AND WITHIN THE DOOR ITSELF, NO PROBLEMS FOUND, WHILE TESTING THE DOOR LOCKING MECHANISM I CYCLED THE LOCK MANY, MANY TIMES UNTIL I NOTICED A GROUND SIGNAL AT THE ALARM MODULE, RE INSTALLED ALARM MODULE TO TEST ALARM SYSTEM, ALARM SYSTEM IS NOW FUNCTIONING AS DESIRED.

SALES REQUESTS DETAIL VEHICLE

270.00

SALES REQUESTS CHECK LEFT REAR BRAKE

CALIPER - IT SEEMS TO BE DRAGGING SLIGHTLY
CONFIRMED CUSTOMER COMPLAINT, REMOVED WHEEL,
RESET CALIPER PISTON INTO CALIPER MULTIPLE TIMES,
APPLYING BRAKES AFTER EACH RESET IN AN ATTEMPT TO
FREE UP THE CALIPER, INSTALLED WHEEL AND TEST DROVE
VEHICLE, ROTOR TEMPS WERE 100* FRONT, 80-90* REAR.
BRAKES ARE OPERATING AS DESIGNED.

SALES STATES WIPER WASHERS ARE NOT OPERATING CORRECTLY

136.17

CONFIRMED CUSTOMER COMPLAINT, FOUND WIPER WASHER TANK TO BE EMPTY, FILLED TANK WITH WASHER FLUID, WIPER WASHERS NOW FUNCTION AS DESIRED

Visit us on the web: www.sscarsnh.com

Service Advisor: Vagi, Tom, Tech: Rundlett, Max; STARLING, KEVIN

Email Address: tvaqi@sscarsnh.com

Page 3 of 4

174 Raymond Rd. Suite B Candia, NH. 03034 Phone: 603-782-0870

INVOICE

885

Org. Est. # 000916

Invoice from History

SEACOAST SPECIALIST CARS LLC

174 RAYMOND ROAD SUITE B

Candia, NH 03034

Cellular 603-782-0870

Printed Date: 05/15/2025 Work Completed: 05/12/2025

1989 Porsche - 944 - 2.7L, In-Line4 (164CI) VIN(A)

Lic#: Odometer In: 113790 Odometer Out: 113865

VIN #: WP0AA0945 KN451115

Part Description / Number Qty Sale Ext **Labor Description** Ext

PERFORM OIL SERVICE

181.56

PERFORMED OIL SERVICE, REPLACED FILTER AND PLUG GASKET, TOPPED OFF VEHICLE TO FACTORY SPEC

SALES REQUESTS PERFORM WATER DRAIN **SERVICE**

340.43

-COWL DRAINS

-SUNROOF DRAINS

PERFORMED WATER DRAIN SERVICE, CLEARED COWL DRAINS AND SUNROOF DRAINS, FOUND DRIVERS SIDE SUNROOF DRAIN PARTIALLY BLOCKED, ALL DRAINS NOW **FUNCTION AS DESIRED**

Org. Estimate 760.80 Revisions 5,848.19 Current Estimate 6,608.99

Revision # 1, Previous Estimate Amount: 760.80, Additional Cost: 5792.78, Revised Estimate: 6553.58, Parts: \$1681.77 Labor: \$3999.24 Sublet: \$0.00 Taxes & Fees: \$111.77 Authorized by - CLARKE, Date - 1/23/2025, Time - 8:59 AM, Initiated By - Shop, Written By - Vaqi, Tom

Revision # 2, Previous Estimate Amount: 6214.86, Additional Cost: 394.13, Revised Estimate: 6608.99, Parts: \$239.19 Labor: \$136.17 Sublet: \$0.00 Taxes & Fees: \$18.77 Authorized bv - . Date - 2/21/2025. Time - 3:31 PM. Initiated Bv - Shop. Written Bv - Vagi. Tom

Revision # 3, Previous Estimate Amount: 6553.58, Additional Cost: -338.72, Revised Estimate: 6214.86, Parts: \$0.00 Labor: \$-226.95 Sublet: \$0.00 Taxes & Fees: \$-111.77 Authorized by - CLARKE, Date - 1/23/2025, Time - 8:59 AM, Initiated By - Shop, Written By - Vaqi, Tom

SubTotal: Tax:

11.068.17

9,102.91

1,965.26

Total:

Labor:

Parts:

11,068.17

Bal Due:

\$0.00

[Payments - X - N/A - \$11,068.17]

Vehicle Received: 1/7/2025 Customer Number: 61

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts and labor is one year or 12,000 miles whichever comes first. Warranty work has to be performed in our shop & cannot exceed the original cost of repair. By signing this invoice, I agree that all charges are correct and legitimate.

Signature

Visit us on the web: www.sscarsnh.com

Date

Email Address: tvaqi@sscarsnh.com